


******* NOTICE *******

In June 2011, Serious Materials, Inc. changed its name to Serious Energy, Inc. In addition, the Company conducted business under other names in the past, including Quiet Solution. For the avoidance of confusion, references to "Quiet Solution" or "Serious Materials" in the reports in general should, going forward, be understood as references to Serious Energy, Inc.

ASTM E 90-09: Laboratory Measurement of Airborne Sound Transmission of Building Partitions and Elements

Orfield Laboratories Inc

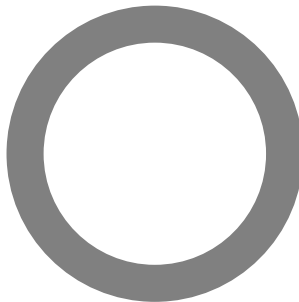

Design Research Testing
Acoustics / Vibration / Vision / Lighting / Architecture / Market Research

TEST

Client: Serious Materials, Inc
Report Date: March 31, 2011
Test Date: March 17, 2011
Test Number: OL 11-0343

ACCREDITATION



For the scope of accreditation under NVLAP code 200248-0

RESULT SUMMARY

STC=58

CLIENT ADDRESS

Serious Materials, Inc.
1250 Elko Drive
Sunnyvale, CA 94089
email: info@SeriousMaterials.com

PREPARED BY

David M. Berg
Orfield Laboratories, Inc.
2709 East 25th Street
Minneapolis MN 55406
Voice (612) 721-2455
FAX (612) 721-2457
e-mail dave@orfieldlabs.com

Prepared by:

David M. Berg
ELECTRONICALLY REPRODUCED SIGNATURE

**David M. Berg
Laboratory Manager**

Reviewed by:

Michael R. Role
ELECTRONICALLY REPRODUCED SIGNATURE

Michael R. Role

Signatures are required on this document for an official laboratory test report. Copies of this document without signatures are for reference only.



Project Sound Transmission Loss Testing 2
 Client Serious Materials, Inc. of 10
 Test OL 11-0343




Orfield Laboratories Inc

Test Date March 17, 2011
Specimen Wall Assembly

Method ASTM Standard E90
Technician D. Berg

Single Number Rating
STC = 58

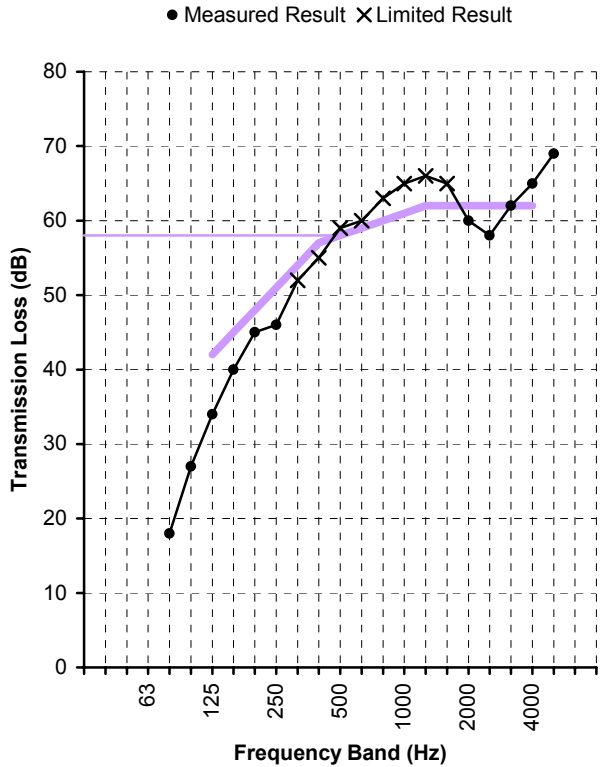

Freq. (Hz)	TL (dB)	Def. (dB)
80	18	
100	27	
125	34	8
160	40	5
200	45	3
250	46	5
315	52*	2
400	55*	2
500	59*	-
630	60*	-
800	63*	-
1000	65*	-
1250	66*	-
1600	65*	-
2000	60	2
2500	58	4
3150	62	-
4000	65	-
5000	69	

Total Deficiencies 31

* Estimate of lower limit

- Assembly Elements** (listed in order from source room side to receiver room side)
- 0.625" (5/8") type X gypsum board; 1.25" type S screw @ 12" O.C.
 - 3-5/8" 25 gauge steel studs @ 24" O.C.
 - 3.5" kraft-faced insulation batts (R13)
 - 0.625" (5/8") Type X gypsum board
 - QuietGlue Pro @ two 28oz tubes per sheet (112oz total)
 - 0.625" (5/8") Type X gypsum board; 2" type S screw @ 12" O.C.





SPECIMEN DESCRIPTION

The specimen under test was one wall assembly. The elements in the assembly are described below the results table and chart. Additional information regarding the specimen may be found in the appendices.

Test results pertain to this specimen only.

INSTALLATION AND DISPOSITION

The 2x4 steel stud frame was originally constructed on March 14, 2011 and used for previous tests in this series. The framing and insulation were retained for subsequent tests in the series. The entire assembly was constructed by independent contractors. Qualified representatives of Orfield Laboratories observed the installation in progress, and visually inspected the specimen prior to testing.

TEST METHODS

The methods followed these published standards:

ASTM E90-09*: *Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions and Elements*

ASTM E413-10: *Classification for Rating Sound Insulation*

The values presented in this report are from single-direction transmission loss measurements.

** Orfield Laboratories, Inc. has been accredited by the U.S. Department of Commerce, National Institute of Standards and Technology (NIST) under their National Voluntary Laboratory Accreditation Program (NVLAP) for this test procedure. This report shall not be used to claim product endorsement by NVLAP or any agency of the U.S. Government.*

CONFIDENTIALITY

The client has full control over this information and any release of information will be only to the client. The specific testing results are deemed to be confidential exclusively for the client's use. Reproduction of this report, except in full, is prohibited.



**APPENDIX A: MEASUREMENT SETUP****Environment**

Temperature	68°F [20.0°C]
Relative Humidity	50%

Specimen Area

Specimen Area	64.5 ft ² [5.99 m ²]
---------------	---

Chamber Volume - Airborne Transmission

Source Room Volume	3284 ft ³ [93.0 m ³]
Receiving Room Volume	8281 ft ³ [234.5 m ³]

INSTRUMENTATION

Description	Brand	Model	S/N
Calibrator	Brüel & Kjær	Type 4230	1379712
Microphone	Brüel & Kjær	Type 4134	1478843
Preamplifier	Brüel & Kjær	Type 2639	1202479
Microphone	Brüel & Kjær	Type 4134	296819
Preamplifier	Brüel & Kjær	Type 2639	1312147
Power Supply	Brüel & Kjær	Type WB1057	n/a
Analyzer	Norsonic	Type 121	31185



APPENDIX B: CALCULATION RESULTS

Freq. Band (Hz)	Specimen T.L. (dB)	95% Conf. (dB)	Flanking Limit (dB)	STC Defic. (dB)
25				
31.5	31.2 §		40	
40	18.0		47	
50	16.5		43	
63	13.9		43	
80	18.4	±2.89	42	
100	26.6	±2.96	45	
125	34.5	±1.32	50	8
160	40.1	±1.16	52	5
200	44.5	±1.46	55	3
250	45.7	±1.62	59	5
315	51.8 §	±0.93	59	2
400	54.9 §	±0.94	61	2
500	58.9 §	±0.78	65	-
630	60.2 §	±0.66	67	-
800	62.9 §	±0.57	71	-
1000	64.9 §	±0.48	74	-
1250	66.2 §	±0.54	73	-
1600	65.1 §	±0.42	74	-
2000	60.3	±0.33	77	2
2500	57.5	±0.60	83	4
3150	61.7	±0.55	85	-
4000	65.1	±0.45	80	-
5000	69.3			
6300	70.3 *			
8000	70.9 *			
10000	66.2 *			
Total deficiencies below STC contour (dB)				31
STC contour [ASTM E413]				58

* Actual transmission loss of specimen may be higher than measured at this frequency band. Signal-to-noise in the receiving room less than 5 dB, therefore the result is "an estimate of the lower limit".

§ Actual transmission loss of specimen may be higher than measured at this frequency band. Result within 10 dB of flanking limit found in separate study, therefore the result may be "potentially limited by the laboratory" due to flanking around the specimen.

Note: 95% Confidence from room qualification data. Flanking Limit from chamber flanking study. Reference sample and repeatability data available upon request. Extended frequency results below 80Hz and above 5000Hz are for reference only.





APPENDIX C: SPECIMEN ASSEMBLY DESCRIPTION

The following table shows the elements in the wall assembly in order from the source room to receiving room. Independent contractors constructed and installed the wall assembly in the laboratory test opening. A qualified representative of Orfield Laboratories observed the installation in process and visually inspected the completed specimen and seals. All materials were weighed prior to installation. Fastener weights are not included.

Overall Mass = 480.1 lb [217.8 kg]

Overall Surface Density = 7.44 PSF [36.34 kg/m²]

Element	Mass lb [kg]	Surf. Dens. PSF [kg/m ²]
0.625" (5/8") type X gypsum board; 1.25" type S screw @ 12" O.C.	142.5 [64.6]	2.21 [10.79]
3-5/8" 25 gauge steel studs @ 24" O.C.	33.2 [15.1]	0.51 [2.51]
3.5" kraft-faced insulation batts (R13)	14.0 [6.4]	0.22 [1.06]
0.625" (5/8") Type X gypsum board		
QuietGlue Pro @ two 28oz tubes per sheet (112oz total)		
0.625" (5/8") Type X gypsum board; 2" type S screw @ 12" O.C.	290.4 [131.7]	4.50 [21.98]

All materials were purchased through independent retail suppliers and were acquired by the independent construction contractors. The frame and insulation were constructed and installed for previous tests in this series for this client, and portions of this specimen assembly were used in subsequent tests in the series.

FRAMING

A 3-5/8", 25 gauge steel stud frame was constructed in the perimeter of the laboratory test specimen opening. The frame consisted of a 25 gauge steel 3-5/8" x 1-1/4" track plate at the top and bottom, and 3-5/8" x 1-1/4" 25 gauge steel studs installed vertically, 24" on center. The track plates and studs were fastened together with 1/2", #8, pan head screws at each intersection. The frame was sealed at the perimeter on both sides with acoustic sealant.

INSULATION

Kraft-faced fiberglass insulation batts were installed in the stud cavities. The insulation batts were 24" wide, 3-1/2" thick (R13) and were friction fit into each of the four stud cavities. The un-faced sides of the insulation batts were oriented towards the source room. Figure 1 is a photograph of the insulated frame before the installation of the sheeting layers.



Figure 1: Insulated steel stud frame viewed from receiving room side

SHEETING

Serious Materials QuietGlue® Pro Glue damping adhesive was pre-laminated into sandwiches between two 5/8" type X gypsum board panels. QuietGlue® Pro was applied in a random pattern from two entire 28 oz. adhesive cartridges over each 4' x 8' gypsum board panel. A second sheet of 5/8" type X gypsum board was applied to the adhesive-covered panel. The sandwiches were then stacked flat and allowed to dry for several days. No additional measures were used to compress the sandwiches. After 10 days, the panels were re-stacked with 2 x 4 wood spacers to allow for drying.

The sandwich panels were constructed by independent contractors at the test laboratory and aged at room temperature for over 35 days prior to testing.

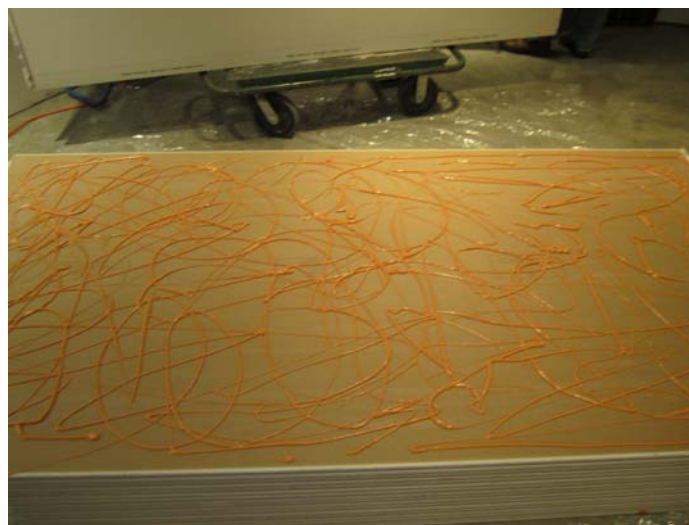


Figure 2: QuietGlue® Pro randomly applied to 5/8" Type X gypsum board



The source room side sheeting was a single layer of 5/8" thick Type X gypsum board. The gypsum board sheets were fastened vertically to the source room side of the steel stud frame with 1-1/4" long, type S drywall screws spaced at 12" on center. The source room layer was comprised of two 4' by 8' sheets, however one of the sheets was cut lengthwise and installed on either side of a complete 4'x8' sheet in order to stagger the seams relative to the receiver room side sheeting.



Figure 3: Source room side sheeting installed and sealed

The receiving room side sheeting layer consisted of pre-assembled sandwiches of two 5/8" thick 4' by 8' sheets of type X gypsum board laminated with QuietGlue® Pro damping adhesive. Fifty-six (56) oz. (two tubes) of QuietGlue® Pro were used for each 4' by 8' gypsum sandwich.

Two full 4' by 8' sandwiches were used to fill the source side test opening. The QuietGlue® Pro and gypsum board sandwiches were fastened to the studs with 2" long, drywall screws spaced at 12" on center. The screws penetrated both layers of gypsum board and directly into the wood studs.



Figure 4: Receiving room side sheeting installed and sealed

Sheeting panels on both sides of the partition were shimmed at installation so equal gaps were at the top and bottom. Gaps were less than 1/4" in all cases. Shims were removed after sheeting was fastened and the perimeter was sealed on the source and receiving room sides with acoustic sealant, 1-7/8" wide, 5 mil aluminum foil tape and 7/8" wide dense putty tape. On both sides of the partition the vertical seams were sealed with acoustic sealant and 1-7/8" wide, 5 mil aluminum foil tape.



APPENDIX D: SINGLE-NUMBER CALCULATION TO ISO 717-1

Freq. Band (Hz)	R_i ($R_i \equiv TL$) (dB)	Ref Curve (dB)	Unfav. Deviat. (dB)	L_{i1} Spectrum (dB)	$L_{i1} - R_i$ Level (dB)	L_{i2} Spectrum (dB)	$L_{i2} - R_i$ Level (dB)
50	16.5						
63	13.9						
80	18.4						
100	26.6	37	10.4	-29.0	-55.6	-20.0	-46.6
125	34.5	40	5.5	-26.0	-60.5	-20.0	-54.5
160	40.1	43	2.9	-23.0	-63.1	-18.0	-58.1
200	44.5	46	1.5	-21.0	-65.5	-18.0	-62.5
250	45.7	49	3.3	-19.0	-64.7	-15.0	-60.7
315	51.8	52	0.2	-17.0	-68.8	-14.0	-65.8
400	54.9	55	0.1	-15.0	-69.9	-13.0	-67.9
500	58.9	56	-	-13.0	-71.9	-12.0	-70.9
630	60.2	57	-	-12.0	-72.2	-11.0	-71.2
800	62.9	58	-	-11.0	-73.9	-9.0	-71.9
1000	64.9	59	-	-10.0	-74.9	-8.0	-72.9
1250	66.2	60	-	-9.0	-75.2	-9.0	-75.2
1600	65.1	60	-	-9.0	-74.1	-10.0	-75.1
2000	60.3	60	-	-9.0	-69.3	-11.0	-71.3
2500	57.5	60	2.5	-9.0	-66.5	-13.0	-70.5
3150	61.7	60	-	-9.0	-70.7	-15.0	-76.7
4000	65.1						
5000	69.3						
Sum =			26.4	$R_{A,1} =$	52.5	$R_{A,2} =$	45.3
$R_w =$			56	$C =$	-4	$C_{tr} =$	-11

$$R_w (C ; C_{tr}) = 56 (-4 ; -11)$$

$$R_w (C ; C_{tr} ; C_{50-3150} ; C_{tr, 50-3150}) = 56 (-4 ; -11 ; -10 ; -22)$$

$$R_w (C ; C_{tr} ; C_{100-5000} ; C_{tr, 100-5000}) = 56 (-4 ; -11 ; -3 ; -11)$$

$$R_w (C ; C_{tr} ; C_{50-5000} ; C_{tr, 50-5000}) = 56 (-4 ; -11 ; -9 ; -22)$$

Note: The calculations in ISO 717-1 are performed based on assumed equivalency of the ASTM and the corresponding ISO test methods. The test herein is performed according to the ASTM standards. Orfield Laboratories *does not* hold accreditation for ISO 140 or ISO 717 under their NVLAP scope of accreditation.

The spectrum adaptation terms C and C_{tr} characterize performance against two specific sound sources, A-weighted pink noise and A-weighted traffic noise respectively. The standard ISO 717-1 includes a discussion of "Use of Spectrum Adaptation Terms" in Annex A (informative).

Each spectrum adaptation term may additionally be reported with extended frequency bands included. A calculation for the primary frequency range is shown above, but all available extended-frequency calculations were performed to compare against corresponding ratings of other specimens

